




## **REACH STACKER**

1998 DIESEL TEREX PPM TFC45 REACHSTACKER

## **EQUIPMENT SPECS**

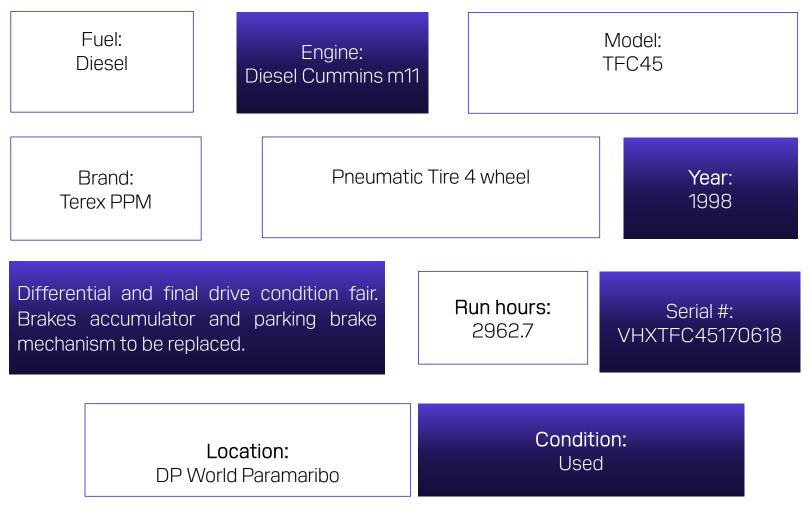

Engine Condition fair, running irratically due to one or two damaged / broken mechanical fuel injectors. Excessive wear on accelerator mechanism. Engine harness in need of replacement. Minor coolant leak on radiator.	Transmission, dana spicer apc100, shifts roughly when cold and when at temperature has some delay shifting gears. Transmission harness in need of replacement.	Steering is hard when working and sometimes locks-up during operation. Steering links minor wear and tear, minor hydraulic oil leak on steering cylinder. Both steering booths damaged. Steering wheel bearing in fair condition.	Cab condition Operator cab and controls in fair condition. Switches and control levers present. Wire harness partially in need of replacement.
Hydraulics system condition poor. Main pressure lower than normal. Steering hydraulic pressure low. Minor hydraulic oil leak on Is block valve and main block valve.	Spreader glide plates and the twist locks in poor condition. Pcb of spreader control box and wiring harness in poor condition. Left spreader rotor gear partially broken. Spreader damping cylinders and damping block valve in poor working condition.	Lights Headlights, working lights, strobe light, back- up alarm in fair condition.	Boom Hydraulic hoses in poor condition. Minor hydraulic oil leak on boom cylinders and telescopic cylinder. Boom outer head had a welding repair job. Boom glide plate are worn.

## **EQUIPMENT PICTURES**



